


TH09



Relative Humidity and Temperature Sensor with I²C Interface

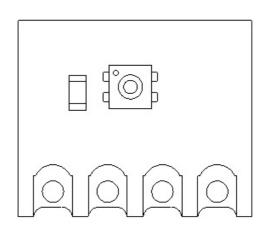

Contents

| ntents | |
|--|----|
| General Description | 4 |
| Key Benefits and Features | 4 |
| Applications | 5 |
| Block Diagram | 5 |
| Pin Assignments | 6 |
| Absolute Maximum Ratings | 7 |
| Electrical Characteristics | 8 |
| I ² C Timing Characteristics | 9 |
| Temperature Sensor Characteristics | 9 |
| Relative Humidity Sensor Characteristics | 10 |
| System Timing Characteristics | 11 |
| Functional Description | 12 |
| Temperature Sensor | 13 |
| Relative Humidity Sensor | 14 |
| RH Accuracy at Various Temperatures | 15 |
| The I ² C Interface | 16 |
| I ² C Operations on Registers | 16 |
| The I ² C Slave Address | 18 |
| Sensor Control | 18 |
| Sensor Timing | 19 |
| The Sensor Readout Registers | 21 |
| Computing CRC-7 | 22 |
| Processing T_VAL and H_VAL | 23 |
| Reading PART_ID, DIE_REV and UID | 25 |
| Register Description | 26 |
| Register Overview | 26 |
| Detailed Register Description | 27 |
| Register PART_ID (Address 0x00) | 27 |
| Register DIE_REV (Address 0x02) | 27 |
| Register UID (Address 0x04) | 27 |
| Register SYS_CTRL (Address 0x10) | 28 |
| Register SYS_STAT (Address 0x11) | 28 |
| Register SENS_RUN (Address 0x21) | 29 |
| Register SENS_START (Address 0x22) | 29 |
| Register SENS_STOP (Address 0x23) | 30 |
| Register SENS_STAT (Address 0x24) | 30 |



| Register T_VAL (Address 0x30) | 31 |
|----------------------------------|----|
| Register H_VAL (Address 0x33) | 31 |
| Application Information | 32 |
| Typical Application | 32 |
| Recommended Operating Conditions | 33 |
| Soldering & Storage Information | 34 |
| Soldering | 34 |
| Storage and Handling | 36 |
| Reconditioning | |
| After Soldering | 37 |
| After Extreme Conditions | 37 |
| Package Drawings & Markings | 38 |



General Description

The TH09 integrates one relative humidity sensor and one high-accuracy temperature sensor. The device is encapsulated in a SMD and DIP package and includes an I²C slave interface for communication with a master processor.

Key Benefits and Features

The benefits and features of TH09, Relative Humidity and Temperature Sensor with I²C Interface are listed below:

Figure 1: Added Value of Using TH09

| Benefits | Features |
|--------------------------------------|--|
| Ultra-accurate | Temperature sensor (±0.15°C) Relative humidity sensor (Typ:±2.0%RH) |
| Wide sensing range | Temperature operating range (-40°C to 100°C) Relative humidity operating range (0% to 100%) |
| Wide operating voltage | • 1.71V to 3.60V |
| Small foot-print | • 10.8mm x 9.1mm x 1.55mm |
| Industry standard two-wire interface | • Standard (100kbit/s) and fast (400kbit/s) I ² C |
| Low power | Automatic low-power standby when not measuring Active current: 6.6µA @ 1Hz (1.8V) Standby current: 40nA |
| Cost effective | Digital pre-calibrated relative humidityand temperature sensor Output directly in %RH and Kelvin Wide supply voltage range |
| High reliability | Long-term stability |



Applications

The TH09 applications include:


- Building Automation / Smart home / HVAC¹
 - Indoor air quality detection
 - Demand-controlled ventilation
 - Smart thermostats
- · Home appliances
 - Air cleaners / purifiers
 - Refrigerators, washing machines, dishwashers, dryers
- Mobiles / Wearables
- IoT devices
- · Portable devices for personal health and wellness
- · Weather stations

Block Diagram

The internal block diagram of TH09 is shown in Figure 2. The I²C (communication) interface is connected to a controller which acts as the command interpreter and as bus master of the internal Advanced Peripheral Bus (APB). The memory and sensors are slaves of the APB. The MTP memory is used to store the sensor calibration parameters and unique ID.

To reduce power consumption the controller only powers the measurement engine when needed.

Figure 2: Functional Blocks of TH09

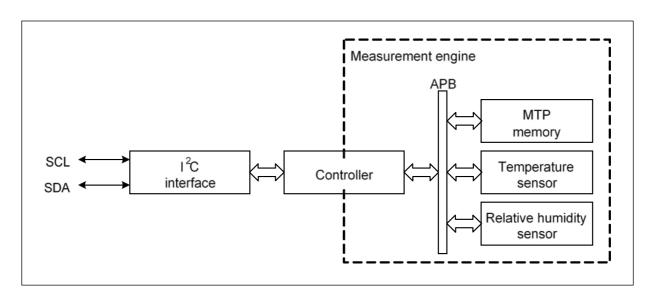

Note(s):

1. HVAC = Heat, Ventilation and Air Conditioning.



Pin Assignments

The TH09 pin assignment is described in Figure 3 and Figure 4.

Figure 3: Pin Diagram of TH09

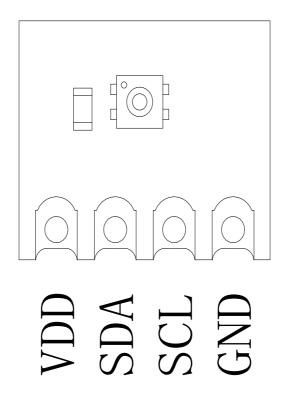


Figure 4: Pin Description of TH09

| Pin Number | Pin Name | Description |
|------------|----------|---|
| 1 | VDD | Supply voltage |
| 2 | SCL | I ² C bus serial clock input (SCL) |
| 3 | SDA | I ² C bus serial bidirectional data line (SDA) |
| 4 | GND | Ground supply voltage; must be connected |



Absolute Maximum Ratings

Stresses beyond those listed under Absolute Maximum Ratings may cause permanent damage to the device. These are stress ratings only. Functional operation of the device at these or any other conditions beyond those indicated under Electrical Characteristics is not implied. Exposure to absolute maximum rating conditions for extended periods may affect device reliability.

Figure 5:
Absolute Maximum Ratings of TH09

| Symbol | Parameter | Min | Max | Units | Comments | |
|----------------------------------|-------------------------------------|------------|-------------|--------|---|--|
| | | Electr | ical Paran | neters | | |
| V_{DD} | Supply voltage | -0.30 4.60 | | V | | |
| I _{Iu} | Latch-up current | 100 | | mA | $I/O; -0.5 V_{dd} < V_{I} < 1.5 V_{dd}; \\ T_{j} < 125 ^{\circ}C$ | |
| | | Electro | ostatic Dis | charge | | |
| ESD _{HBM} | Human body model; all pins | ±2000 | | V | JEDEC JS-001-2014 | |
| ESD _{CDM} | Charged model device; all pins | ±500 | | V | JEDEC JS-002-2014 | |
| Operating and Storage Conditions | | | | | | |
| MSL | Moisture sensitivity level | 1 | | | Maximum floor life time is unlimited | |
| T_{STRG} | Storage temperature | 10 | 50 | °C | | |
| RH_NC | Relative humidity (non-condensing) | 20 | 60 | %RH | Preferably in sealed ESD bag | |
| T _A | Operating ambient temperature | -40 | 100 | °C | | |
| H _A | Operating ambient relative humidity | 0 | 100 | %RH | | |



Electrical Characteristics

All limits are guaranteed. The parameters with min and max values are guaranteed with production tests or SQC (Statistical Quality Control) methods.

Figure 6: Electrical Characteristics

| Symbol | Parameter | Conditions | Min | Тур (1) | Max | Unit |
|-----------------|--------------------------|---|---------------------|-------------|----------------------|------|
| V_{DD} | Supply voltage | Max ripple 100mV _{PP} between 0-1MHz | 1.71 | 1.80 (3.30) | 3.60 | V |
| | | Standby state | | 0.04 (0.5) | | μΑ |
| I _{DD} | Supply current | Continuous run mode | | 58 (61) | | μΑ |
| DD | | T and RH measurement at 1Hz | | 6.6 (7.1) | | μΑ |
| V_{IH} | High-level input voltage | | 0.7×V _{DD} | | V _{DD} +0.5 | V |
| V _{IL} | Low-level input voltage | | -0.5 | | 0.3×V _{DD} | V |
| | Low-level | $V_{OL} = 0.4V$ | 3 | | | mA |
| I _{OL} | output current | $V_{OL} = 0.6V$ | 6 | | | mA |

Note(s):

1. Values in parenthesis are for V_{DD}=3.30 V.

 $2.T_A = 25$ °C and at 1.80 V supply voltage, unless otherwise specified.



I²C Timing Characteristics

TH09 is compliant to the I²C standard; it supports standard and fast mode as per I²C-bus specifications [UM10204, I²C-bus specification and user manual, Rev. 6, 4 April 2014].

Temperature Sensor Characteristics

Figure 7: Temperature Sensor Characteristics

| Symbol | Parameter | Conditions | Min | Тур | Max | Unit |
|-------------------|-----------------------------|---|------|-------|-----|---------|
| T_{range} | Temperature range | | -40 | | 100 | °C |
| - | Temperature | $T_A = 0$ °C to 70°C; | | 0.15 | 0.2 | °C |
| T _{acc} | accuracy ³ | $T_A = -40^{\circ}C \text{ to } 100^{\circ}C;$ | | | 0.3 | °C |
| T _{res} | Temperature resolution | | | 0.016 | | °C |
| t _{resp} | Response time ² | T step of 10°C by submersion (in 0°C to 70°C range); τ63 % ¹ | | 1 | | S |
| T _{rep} | Temperature repeatability | 3σ of consecutive measurement values at constant conditions | -0.1 | | 0.1 | °C |
| ΔΤ | Temperature long term drift | | | 0.005 | | °C/year |

Note(s):

^{1.63%} indicates that if a T step of 10°C, e.g. from 20°C to 30°C is made, it will take tresp seconds to reach 63% of that step.

^{2.} In an application the temperature response time depends on heat conductivity of the sensor PCB.

^{3.} Typical and maximum accuracy specification refers to, respectively, 2 and 3 standard deviations, assuming normal distribution of accuracy errors. After industrial calibration, on each production lot through statistical analysis, a population of sensors is tested on typical room conditions (e.g. 25°C, 45%RH) and only lots passing the verification qualify for customer deliveries.



Relative Humidity Sensor Characteristics

Figure 8: Relative Humidity Sensor Characteristics

| Symbol | Parameter | Conditions | Min | Тур | Max | Unit |
|--------------------|--|--|-----|-------|-----|----------|
| H _{range} | Relative humidity range | | 0 | | 100 | %RH |
| 11 | Relative humidity | T _A =25°C; RH=0%RH to 85% RH; excluding hysteresis | | 2 | 3 | %RH |
| H _{acc} | accuracy ³ | T _A =25°C; RH=>85%RH to 95% RH; excluding hysteresis | | 3 | 4 | %RH |
| H _{res} | Relative humidity resolution | | | 0.03 | | %RH |
| t _{resp} | Response time ⁴ | RH step of 20%RH (in 40%RH to 80%RH range); $\tau 63\%$; 1m/s flow; $T_A = 25$ °C | | | 3 | S |
| H _{hys} | Relative humidity hysteresis | $T_A = 25$ °C; RH = 20%RH to 90%RH; 2 hours exposure time | | ±0.55 | | %RH |
| H _{rep} | Relative humidity repeatability | 3σ of consecutive measurement values at T_A = 25°C and RH = 40%RH | | ±0.1 | | %RH |
| ΔΗ | Relative humidity long term drift ² | T _A = 25°C | | 0.25 | | %RH/year |

Note(s):

- 1.63% indicates that if an RH step of 20%RH is made, e.g. from 40%RH to 60%RH, it will take t_{resp} seconds to reach 63% of that step.
- 2. Values are linearized averages over the lifetime of the product. Due to non-linear behavior a larger drift is expected in the first years.
- $3. \ Typical \ and \ maximum \ accuracy \ specification \ refers \ to, \ respectively, 2 \ and 3 \ standard \ deviations, \ assuming \ normal \ distribution \ of \ accuracy \ error.$
- 4. Device only performance. Application response time will depend on the design-in of thesensor.



System Timing Characteristics

Figure 9: System Timing Characteristics

| Symbol | Parameter | Conditions | Min | Тур | Max | Unit |
|----------------------|---------------------------|--|-----|-----|-----|------|
| t _{booting} | Booting time ¹ | | | 1 | 1.2 | ms |
| | Conversion time | T only, single shot (includes t _{booting}) | | 105 | 110 | ms |
| | | T only, continuous | | 104 | 109 | ms |
| t _{conv} | | T and RH, single shot (includes t _{booting}) | | 122 | 130 | ms |
| | | T and RH, continuous | | 225 | 238 | ms |

Note(s):

1. Time in transient state booting (see Figure 10).




Functional Description

The TH09 integrates two sensor blocks: temperature and relative humidity.

The device is normally in the *standby* state (Figure 10): the measurement engine (see Figure 2) is unpowered, but the I²C interface is operational and register write/read operation can be performed. When a measurement command is given, the device is first *booting* to *active* then it starts a measurement. When the measurement is completed, the device returns to the *standby* state. Since the I²C interface is operational in *standby*, the measurement result can be read out.

Figure 10: The TH09 Power States

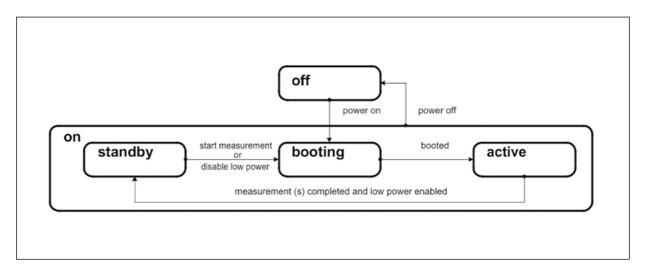

In continuous run mode (see Register SENS_RUN) or when low power is disabled (see Register SYS_CTRL), the device remains in *active* state.

The system power status is observable (see Register SENS_STAT).

When powering up from *off*, the device is first booting to active, but then falls immediately back to *standby* (since no measurement is pending, and by default low power is enabled).


Note that the booting state is a transient state (the system automatically transitions to the next state - *active*); the booting time is given in Figure 9.



Temperature Sensor


The temperature sensor block (Figure 11) determines the ambient temperature, and outputs a calibrated value in Kelvin.

Figure 11:
Band Gap Temperature Measurement

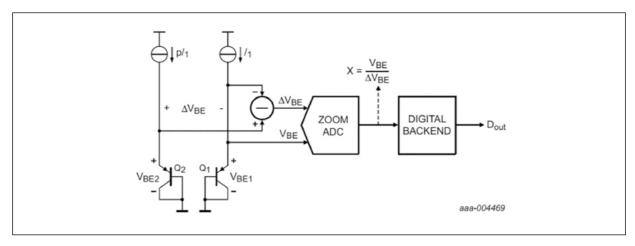

The temperature is measured using a high-precision (12 bits) zoom-ADC. The analog part is able to measure a strongly temperature dependent $X = V_{BE}/\Delta V_{BE}$. The X is found by first applying a coarse search (successive approximation), and then a sigma-delta in a limited range. The accuracy of the sensor is shown in Figure 12. The conversion time is shown in Figure 9.

Figure 12:
Absolute Accuracy of the Temperature Sensor

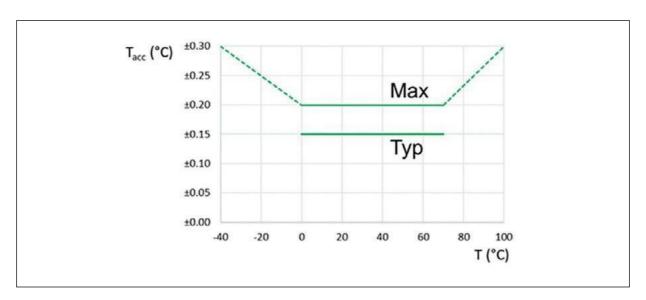

Note(s):


1. Dash line indicates natural physical behavior



Relative Humidity Sensor


The relative humidity sensor as shown in Figure 13 determines the ambient relative humidity and outputs a calibrated value in RH. The transducer (the C_X on the top left) consists of a large-area capacitor covered with a humidity-sensitive material. The capacitance change is proportional to the change in relative humidity, and has a linear dependence on temperature. The capacitance is measured by a high-precision 2^{nd} order sigma-delta converter.

Figure 13: Relative Humidity Sensor

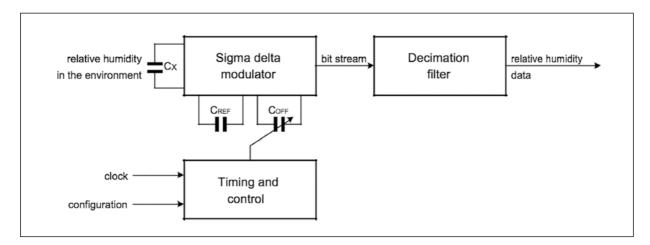

Reading the relative humidity sensor will output a temperature compensated value. The accuracy of the sensor is shown in Figure 14. The conversion time is shown in Figure 9.

Figure 14: Absolute Accuracy of the Relative Humidity Sensor at 25°C

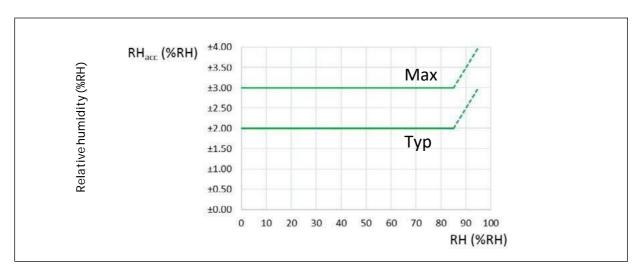

Note(s):

1. Dash line indicates natural physical behavior.




RH Accuracy at Various Temperatures

Typical RH accuracy at 25°C is defined in Figures 8 and 14. The relative humidity accuracy has also been evaluated at temperatures other than 25°C. The values shown in Figure 15 are an indication only, which may be important for your application, but are not guaranteed.

Figure 15:
Accuracy of Relative Humidity Measurements (%RH) as Function of Temperature and Relative Humidity

Absolute accuracy of relative humidity measurements (%RH)

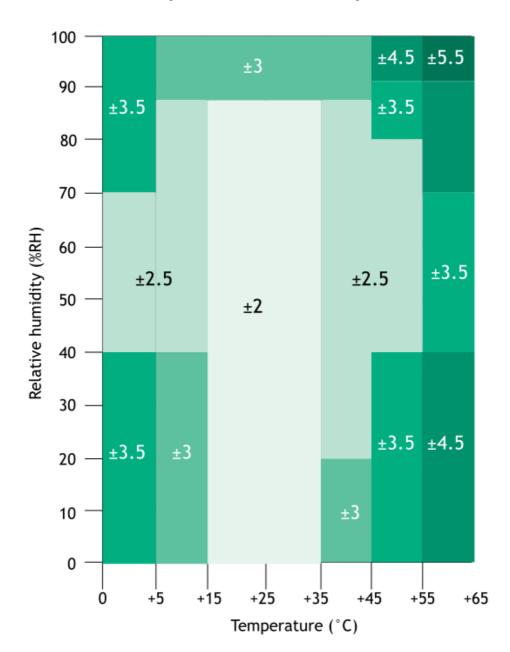



The I²C Interface

The TH09 is an I²C slave device. The I²C interface supports standard (100kbit/s) and fast (400kbit/s) mode.

Details on I²C protocol is according to I²C-bus specifications [UM10204, I²C-bus specification and user manual, Rev. 6, 4 April 2014].


The device applies all mandatory I²C protocol features for slaves: START, STOP, Acknowledge, 7-bit slave address. TH09 does not use clock stretching.

None of the other optional features (10-bit slave address, General Call, Software reset, or Device ID) are supported, nor are the master features (Synchronization, Arbitration, START byte).

I²C Operations on Registers

The TH09 uses a register model to interact with it. This means that an I²C master can write a value to one of the registers of a slave, or that it can read from one of the registers of the slave. In the TH09, registers are addressed using 1 byte. The values stored in a register are also 1 byte. However, the TH09 implements "auto increment" which means that it is possible to read, for example, two bytes by supplying the address of the first byte and then reading two bytes.

Figure 16: I²C Transaction Formats

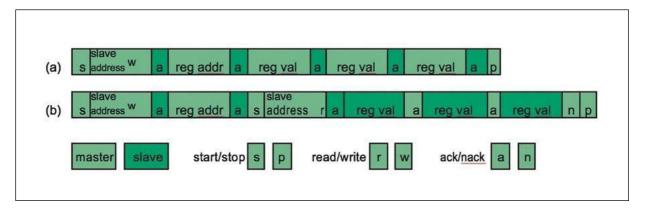

A typical *write* transaction (see Figure 16) therefore has the following format. The master initiates a transaction with a so-called start condition "s". This blocks the bus. Next, the master sends the 7 bits TH09 *slave address* followed by a 1 bit direction (a 0 indicating write "w"). This byte is acknowledged "a" by the slave. The master continues by sending the 8 bit register address, which is acknowledged by the slave.



This register address is stored in an internal CRA register ("Current Register Address"). Finally, the master sends the 8 bit *register value*, which is acknowledged by the slave (or nack'ed when the address is not writeable). This value is written to the register pointed to by the CRA, and the CRA is incremented by

1. Optionally, the master sends more 8 bit values, for the next registers (auto incrementing CRA), each of which is (n)ack'ed by the slave. Finally, the master generates a stop condition "p", unblocking the bus for other transactions.

A *read* transaction (see Figure 16) starts with a write (of the register address), followed by a read. Consequently, it has the following format. The master initiates the transaction with a start condition. Next, the master sends the 7 bits TH09 *slave address* followed by a 1 bit direction (a 0 indicating write). This byte is acknowledged by the slave. The master continues by sending the 8 bit *register address*, which is acknowledged by the slave and stored in the CRA register. Then the master sends another start condition (a so-called repeated start condition, keeping the bus blocked) followed by the 7 bits TH09 *slave address* followed by a 1 bit direction (a 1 indicating read "r"), which is acknowledged by the slave. Next, the slave sends an 8 bits *register value* from the register pointed to by the CRA register, and the CRA is incremented by 1. This byte is acknowledged by the master. The master may read another 8 bits (auto increment feature) from the slave and acknowledge that, until the master sends a nack "n" followed by a stop to unblock the bus.

The TH09 has an 8 bit address space, potentially addressing 256 registers. In reality, only few addresses are actually backed by a register (see Register Overview). All other addresses are reserved. A write transaction to a reserved (or read-only) register causes a not-acknowledge. A read transaction for a reserved register will return a 0.




The I²C Slave Address

The TH09 is an I^2C slave device with a fixed slave address of 0x43. This means that the first byte after a start condition is 1000 011x, where x indicates the data direction, so 0x86 (1000 0110) for write and 0x87 (1000 0111) for read.

Sensor Control

The TH09 contains a temperature and a relative humidity sensor. Both sensors have two run modes: single shot run mode and continuous run mode (enabled via SENS_RUN), see Figure 17.

Figure 17:
The Sensor Modes

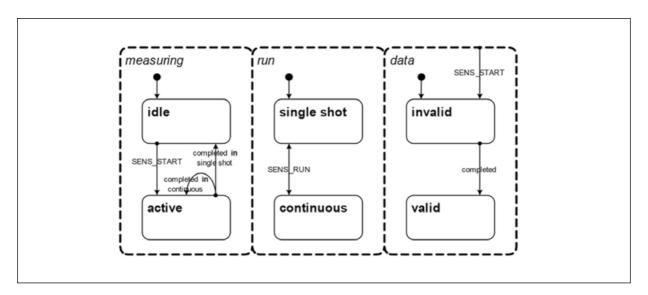

When in the *single shot* run mode, starting a measurement is under control of the master. By default a sensor is idle; it can be started by writing a 1 to the corresponding bit in SENS_START. After a start, the sensor stops when the measurement is completed. Whether a sensor is idle or active measuring can be detected by reading SENS_STAT. The measured values can be obtained via their respective readout registers (T_VAL and H_ VAL). Writing to SENS_STOP in single shot has no effect.

When in the *continuous* run mode, the sensor performs measurement after measurement after a 1 is written to the corresponding bit in SENS_START. The result of each measurement is stored in the aforementioned readout registers. Writing 1 to the corresponding bit in SENS_STOP stops the repeat cycle after the ongoing measurement is completed.




The device operates in a step-wise way. In each step, either one or both sensors are active. The step ends when the measurement(s) are completed. For the next step, the device inspects its register settings, and either one or both sensors are activated again, or there is no measurement request and the device goes into standby (unless low power is disabled by SYS_ CTRL).

This means that multiple writes to START during a step have no effect; the measurement is started once, and only a write to START after the measurement has completed starts the measurement again. Similarly, multiple writes to STOP have no effect; when the measurement completes (in continuous mode) the stop request is effectuated once. When START and STOP are both requested, the measurement is started, and when completed, stopped.

Sensor Timing

There are differences between single shot measurements and continuous measurements. Figure 18 shows the timing of a single shot T measurement.

Figure 18: Single Shot Temperature Measurement

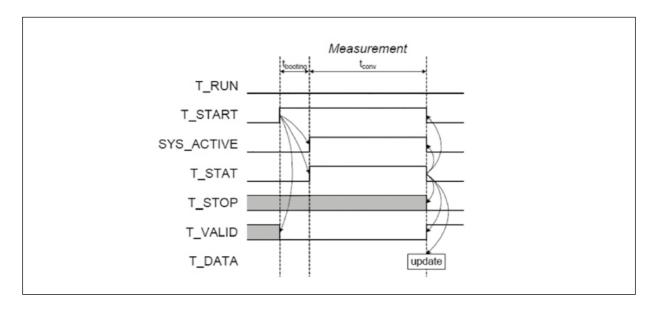


Signal T_RUN is written low to select a single shot measurement. Note that T_STOP is typically low (cleared by a previous measurement), but its state is ignored in a single shot measurement. T_START is written high to start measuring: T_VALID in T_VAL is cleared and the device starts booting to active. Once active SYS_ACTIVE goes high, and measurement starts (T_STAT goes high).

When the measurement is completed (T_STAT goes low) the data register (T_DATA) becomes valid (T_VALID goes high) and the device goes back to *standby* (SYS_ACTIVE goes low). The T_START and T_STOP are cleared.



Figure 19 shows the timing of a continuous T measurement.

Figure 19: Continuous Temperature Measurement

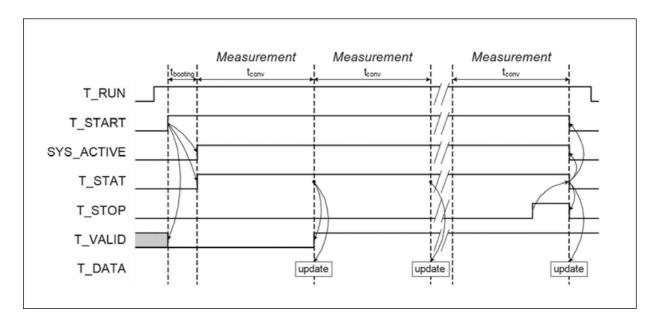

Signal T_RUN is written high to select a continuous measurement. Note that T_STOP is typically low (cleared by a previous measurement), and it should stay low otherwise continuous mode will stop after one measurement. T_START is written high to start measuring: T_VALID in T_VAL is cleared and the device starts *booting* to *active*. Once *active* SYS_ACTIVE goes high, and measurement starts (T_STAT goes high).

When the first measurement is completed the data register (T_DATA) becomes valid (T_VALID goes high), and the device starts a new measurement. When the next measurement is completed the data register (T_DATA) is updated; T_VALID stays high. The device starts a new measurement.

At some point in time, a stop command is given (T_STOP is written high). As soon as the current measurement is completed, the data register (T_DATA) is once more updated and the device goes back to *standby* (SYS_ACTIVE goes low). The T_START and T_STOP are cleared.


Note that writes to the SENS_XXX registers only take effect when no measurement is ongoing. In other words, measurements are always sequential (so we can have three types: T only, RH only or T and RH and changes occur when the measurements are finished.



The Sensor Readout Registers

The sensor readout registers (T_VAL and H_VAL) consist of three parts: the actual measured data, a valid flag and a checksum (see Figure 20). It is not mandatory to read the valid flag or the checksum when reading the data.

Figure 20: The Layout of the Sensor Readout Registers

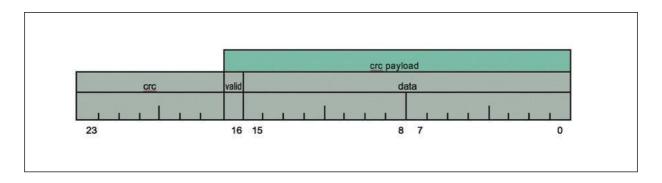

The *checksum* is a cyclic redundancy check over the data and the valid flag; the stored checksum is the result of CRC-7 (polynomial x7+x3+1, see *https://en.wikipedia.org/wiki/Cyclic_redundancy_check*) with 0x7F as initial vector (*i.e. with all bits flipped*), see Computing CRC-7 for sample C code.

The *valid* flag is cleared when a measurement is started (irrespective of the run mode). Once the measurement is completed the valid flag is set. In continuous mode, a new measurement is then started without clearing the valid flag; so data is always valid after the first measurement (but it might be several milliseconds old).

The *data* field is a 16 bits fixed point number, whose format and unit depends on the sensor (see Register T_VAL and Register H_VAL).

To ensure consistent view, these multi-byte readout registers are double buffered. When the first byte (i.e. the byte with the lowest register address) is read, the device copies all bytes from the measurement registers to the I²C registers, and then the value from the first I²C register is returned. Reads to the other bytes of the multi-byte register (i.e. with higher register addresses) are always directly from the I²C registers.



Computing CRC-7

CRC algorithm uses a 7 bit polynomial (see lines 4, 5, and 6), and a 17 bit payload. The crc7() function below uses the following constants defining the CRC width, (the coefficients of the) polynomial and the initial vector (start value of the CRC), and some constants describing the payload data size.

```
//
                               7654
                                      3211
// Polynomial
                        0b
                               1000
                                       1001 \sim x^{7}+x^{3}+x^{0}
                        0x
                               8
#define CRC7WIDTH
                        7
                               // 7 bits CRC has polynomial of 7th order (has 8 terms)
#define CRC7POLY
                        0x89 // The 8 coefficients of the polynomial
#define CRC7IVEC
                        0x7F // Initial vector has all 7 bits high
// Payload data
#define DATA7WIDTH
                        17
#define DATA7MASK
                        ((1UL<<DATA7WIDTH)-1) // 0b 0 1111 1111 1111 1111
#define DATA7MSB
                        (1UL<<(DATA7WIDTH-1)) // 0b 1 0000 0000 0000 0000
```


The crc7(val) function returns the CRC-7 of a 17 bits value val.

```
// Compute the CRC-7 of 'val' (should only have 17 bits) uint32_t crc7( uint32_t val ) {
    // Setup polynomial
    uint32_t pol= CRC7POLY;
    // Align polynomial with data
    pol = pol << (DATA7WIDTH-CRC7WIDTH-1);
    // Loop variable (indicates which bit to test, start with highest)
    uint32_t bit = DATA7MSB;
    // Make room for CRC value
    val = val << CRC7WIDTH:
    bit = bit << CRC7WIDTH;
    pol = pol <<CRC7WIDTH;
    // Insert initial vector
    val |= CRC7IVEC;
    // Apply division until all bits done
    while( bit & (DATA7MASK<<CRC7WIDTH) ) {</pre>
        if( bit & val ) val ^= pol;
        bit >>= 1;
        pol >>= 1;
    }
    return val;
}
```



Suppose that T_VAL (address 30, 31 and 32) reads FD 49 0B, corresponding (little endian) with the number 0B49FD, see Figure 21. This leads to a CRC of 05 over a payload of 149FD. See the next paragraph for details on processing this data.

Figure 21: T_VAL Readout

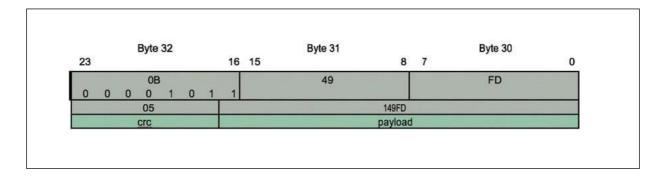

Processing T_VAL and H_VAL

This paragraph shows a possible implementation of reading T and RH.

The following fragment starts a combined single shot measurement, waits and reads the measurement results. It assumes the availability of i2c_reg_write and i2c_reg_read primitives as well as a sleep routine (rtk_tsk_sleep). The format specifiers in the printf's are kept simple (%d instead of %ld or even PRId32 from inttypes.h); they need adaptation on e.g. 16 bits platforms.



The following fragment processes the T measurement as available in t_val . It relies on the crc7() function as shown previously.

```
// Extract (and print) the fields
uint32_t t_data = (t_val>>0 ) & 0xffff;
uint32_t t_valid= (t_val>>16) & 0x1;
uint32_t t_crc = (t_val>>17) & 0x7f;
printf("TH09: T: %06x %02x %01x %04x\n", t_val, t_crc, t_valid,
t_data ); // Check the CRC
uint32_t t_payl = (t_val>>0 ) & 0x1ffff;
bool t_crc_ok= crc7(t_payl)==t_crc;
// Convert to float (and print)
float TinK = (float)t_data / 64; // Temperature in Kelvin
float TinC = TinK - 273.15; // Temperature in Celsius
float TinF = TinC * 1.8 + 32.0; // Temperature in Fahrenheit
printf("TH09: T: (i2c=%d crc=%d valid=%d) %5.1fK %4.1fC %4.1fF\n", i2c_ok, t_crc_ok, t_valid,
TinK, TinC, TinF);
```

The following fragment processes the RH measurement as available in h_val. It is similar to the t_val processing.

```
// Extract (and print) the fields
uint32_t h_data = (h_val>>0) & 0xffff;
uint32_t h_valid= (h_val>>16) & 0x1;
uint32_t h_crc = (h_val>>17) & 0x7f;
printf("TH09: H: %06x %02x %01x %04x\n", h_val, h_crc, h_valid,
h_data); // Check the CRC
uint32_t h_payl = (h_val>>0) & 0x1ffff;
bool h_crc_ok= crc7(h_payl)==h_crc;
// Convert to float (and print)
float H= (float)h_data/512; // relative humidity (in %)
printf("TH09: H: (i2c=%d crc=%d valid=%d) %2.0f%\n", i2c_ok, h_crc_ok,h_valid, H);
```

If registers 30 to 35 would contain fd 49 0b 6c 2e f5 (i.e. $\texttt{T_VAL}$ in blue and $\texttt{H_VAL}$ in green) the code would print

```
TH09: T: 0b49fd 05 1 49fd
TH09: T: (i2c=1 crc=1 valid=1) 296.0K 22.8C 73.0F
TH09: H: f52e6c 7a 1 2e6c
TH09: H: (i2c=1 crc=1 valid=1) 23%
```



Reading PART_ID, DIE_REV and UID

The first 3 registers (PART_ID, DIE_REV and UID) are only available in *active* state. There are two ways to read them:

- · Dedicated read action
 - Disable low power (set LOW_POWER to 0)
 - Wait for t_{booting} to get into active state (check SYS_ACTIVE to be 1)
 - Read the ID register(s)
 - Re-enable low power (set LOW_POWER to 1)
- Piggybacking on a measurement
 - Start a measurement (write 0b01, 0b10, or 011 to SENS_START)
 - Wait for tbooting to get into active state (check SYS_ACTIVE to be 1)
 - Read the ID register(s)
 - Ensure the device is still in active state (check SYS_ACTIVE to be 1)



Register Description

This section describes the I²C registers of the TH09.

Register Overview

Note that some registers are actually spread over multiple addresses. For example, T_VAL at address 30 is spread over 3 addresses (its "Size" is 3). This could be rephrased as follows: there are three registers T_VAL0, T_VAL1, and T_VAL2 at addresses 30, 31, and 32 respectively.

Figure 22: Register Overview

| Address | Name | Size | Access | Description |
|---------|-----------------------|------|--------------------|--|
| 0x00 | PART_ID | 2 | Read (active only) | Identifies the part as TH09 |
| 0x02 | DIE_REV | 2 | Read (active only) | Identifies the die revision version |
| 0x04 | UID | 8 | Read (active only) | Unique identifier |
| 0x0C | <reserved></reserved> | 4 | | |
| 0x10 | SYS_CTRL | 1 | Read/Write | System configuration |
| 0x11 | SYS_STAT | 1 | Read | System status |
| 0x12 | <reserved></reserved> | 14 | | |
| 0x21 | SENS_RUN | 1 | Read/Write | The run mode (single shot or continuous) |
| 0x22 | SENS_START | 1 | Write | Start measurement |
| 0x23 | SENS_STOP | 1 | Write | Stop continuous measurement |
| 0x24 | SENS_STAT | 1 | Read | Sensor status (idle or measuring |
| 0x25 | <reserved></reserved> | 11 | | |
| 0x30 | T_VAL | 3 | Read | Temperature readout |
| 0x33 | H_VAL | 3 | Read | Relative humidity readout |
| 0x36 | <reserved></reserved> | 202 | | |



Detailed Register Description

Register PART_ID (Address 0x00)

This 2 byte register identifies the part number in little endian (TH09). This register is only available in *active* state; see Reading PART_ID, DIE_REV and UID for instructions of reading it.

Figure 23: Register PART_ID

| Addr | ess 0x00 | PART_ID | | | | |
|------|------------|---------|--------|-----------------------------------|--|--|
| Bits | Field Name | Default | Access | Field Description | | |
| 15:0 | PART_ID | 0x0210 | Read | Identifies this device as an TH09 | | |

Register DIE_REV (Address 0x02)

This 2 byte register identifies the die revision number of the TH09 device. This register is only available in active state; see Reading PART_ID, DIE_REV and UID for instructions of reading it.

Figure 24: Register DIE_REV

| Addr | ess 0x02 | DIE_REV | | | | |
|------|------------|---------|--------|--|--|--|
| Bits | Field Name | Default | Access | Field Description | | |
| 15:0 | DIE_REV | 0x0001 | Read | Identifies the die revision version number | | |

Register UID (Address 0x04)

This 8 byte register uniquely identifies a single device among all TH09 devices. This register is only available in active state; see Reading PART_ID, DIE_REV and UID for instructions of reading it.

Figure 25: Register UID

| Address 0x04 | | | | UID |
|--------------|------------|---------|--------|-------------------|
| Bits | Field Name | Default | Access | Field Description |
| 63:0 | UID | Varies | Read | Unique device id |



Register SYS_CTRL (Address 0x10)

This 1 byte register controls the system.

Figure 26: Register SYS_CTRL

| Addre | Address 0x10 | | SYS_CTRL | | |
|-------|-----------------------|----------|------------|--|--|
| Bits | Field Name | Default | Access | Field Description | |
| 7 | RESET | 0 | Write | Write 1 to reset the device | |
| 6:1 | <reserved></reserved> | 0b000000 | Read/Write | Keep to 0's | |
| 0 | LOW_ POWER | 0b1 | Read/Write | Controls the automatic low power. 0: Disabled (device stays in active) 1: Enabled (device goes to standby when measurement complete) | |

Register SYS_STAT (Address 0x11)

This 1 byte register indicates the system status.

Figure 27: Register SYS_STAT

| Addr | ess 0x11 | SYS_STAT | | | |
|------|-----------------------|-----------|--------|--|--|
| Bits | Field Name | Default | Access | Field Description | |
| 7:1 | <reserved></reserved> | 0b0000000 | Read | Reads 0's | |
| 0 | SYS_ACTIVE | 0b1 | Read | The system power state 0: System is in <i>standby</i> or booting state 1: System is in <i>active</i> state | |



Register SENS_RUN (Address 0x21)

This 1 byte register configures the run modes (single shot or continuous) of the sensors.

Figure 28:

Register SENS_RUN

| Address 0x21 | | | SENS_RUN | | |
|--------------|-----------------------|----------|------------|---|--|
| Bits | Field Name | Default | Access | Field Description | |
| 7:2 | <reserved></reserved> | 0b000000 | Read/Write | Keep to 0's | |
| 1 | H_RUN | 0b0 | Read/Write | The run mode of the relative humidity sensor 0: Relative humidity sensor operates in single shot mode 1: Relative humidity sensor operates in continuous mode | |
| 0 | T_RUN | 0b0 | Read/Write | The run mode of the temperature sensor 0: Temperature sensor operates in single shot mode 1: Temperature sensor operates in continuous mode | |

Register SENS_START (Address 0x22)

This 1 byte register starts a measurement for the sensors.

Figure 29:

Register SENS_START

| Address 0x22 | | SENS_START | | | |
|--------------|-----------------------|------------|------------|--|--|
| Bits | Field Name | Default | Access | Field Description | |
| 7:2 | <reserved></reserved> | 0b000000 | Read/Write | Keep to 0's | |
| 1 | H_START | 0b0 | Read/Write | Write a 1 to start a relative humidity sensor measurement Writing 0 has no effect (helps in multiple access) | |
| 0 | T_START | 0b0 | Read/Write | Write a 1 to start a temperature sensor measurement Writing 0 has no effect (helps in multiple access) | |



Register SENS_STOP (Address 0x23)

This 1 byte register stops a continuous measurement for the sensors.

Figure 30:

Register SENS_STOP

| Address 0x23 | | SENS_STOP | | |
|--------------|-----------------------|-----------|--------|--|
| Bits | Field Name | Default | Access | Field Description |
| 7:2 | <reserved></reserved> | 0b000000 | Write | Write 0's |
| 1 | H_STOP | 0b0 | Write | Write a 1 to stop a continuous relative humidity sensor measurement Writing 0 has no effect (helps in multiple access) |
| 0 | T_STOP | 0b0 | Write | Write a 1 to stop a continuous temperature sensor measurement Writing 0 has no effect (helps in multiple access) |

Register SENS_STAT (Address 0x24)

This 1 byte register indicates the measuring status (idle or active) of the sensors.

Figure 31:

Register SENS_STAT

| Addı | Address 0x24 | | SYS_STAT | | | |
|------|-----------------------|----------|----------|--|--|--|
| Bits | Field Name | Default | Access | Field Description | | |
| 7:2 | <reserved></reserved> | 0b000000 | Read | Write 0's | | |
| 1 | H_STAT | 0b0 | Read | Indicates the measuring status of the relative humidity sensor 0: Relative humidity sensor is idle (not measuring) 1: Relative humidity sensor is active measuring | | |
| 0 | T_STAT | 0b0 | Read | Indicates the measuring status of the temperature sensor 0: Temperature sensor is idle (not measuring) 1: Temperature sensor is active measuring | | |



Register T_VAL (Address 0x30)

This 3 byte register contains the last measured temperature data. Furthermore it has a data valid flag and a CRC over the former two. Note that these bytes are double buffered; they are latched in by accessing the first byte, see The Sensor Readout Registers for details.

See Section Processing T_VAL and H_VAL for example code of processing this register.

Figure 32: Register T_VAL

| Address 0x30 | | T_VAL | | |
|--------------|------------|---------|--------|--|
| Bits | Field Name | Default | Access | Field Description |
| 23:17 | T_CRC | - | Read | CRC over T_DATA and T_VALID |
| 16 | T_VALID | - | Read | Data valid indication (1 means T_DATA is valid) |
| 15:0 | T_DATA | - | Read | Last measured temperature, stored as a little endian 16 bits unsigned value in 1/64 Kelvin |

Register H_VAL (Address 0x33)

This 3 byte register contains the last measured relative humidity data. Furthermore it has a data valid flag and a CRC over the former two. Note that these bytes are double buffered; they are latched in by accessing the first byte, see The Sensor Readout Registers for details.

See Processing T_VAL and H_VAL for example code of processing this register.

Figure 33: Register H_VAL

| Address 0x33 | | H_VAL | | | |
|--------------|------------|---------|--------|---|--|
| Bits | Field Name | Default | Access | Field Description | |
| 23:17 | H_CRC | - | Read | CRC over H_DATA and H_VALID | |
| 16 | H_VALID | - | Read | Data valid indication (1 means H_DATA is valid) | |
| 15:0 | H_DATA | - | Read | Last measured relative humidity, stored as a little endian 16 bits unsigned value in 1/512%RH | |




Application Information

Typical Application

Figure 34 shows a typical application.

Figure 34:

TH09 Typical Application

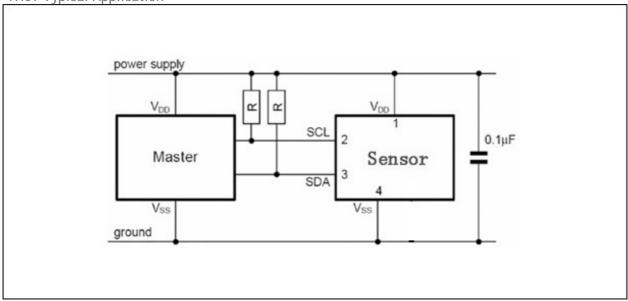




Recommended Operating Conditions

The recommended temperature and relative humidity operating range for the TH09 is 5°C to 60°C and 20%RH to 80%RH, see Figure 35. Long term exposure outside these recommended operating conditions may temporarily offset the relative humidity readout.

After such exposure, the device will slowly return to its accuracy limits at 25°C (can be matter of hours or weeks, depending on stress conditions). Re-conditioning (bake + hydration) will accelerate kinetics of returning to its accuracy limits at 25°C.

Prolonged exposure to extreme conditions may accelerate drift, which might not be fully recoverable: e.g. after 96h at 85°C/85%RH offset can be around +6%RH.

Figure 35: Recommended Operating Conditions

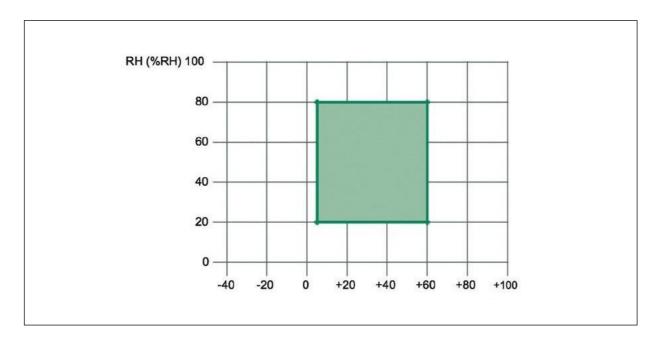




Soldering & Storage Information

Soldering

The TH09 uses a cavity package. This package can be soldered using a standard reflow process in accordance with IPC/JEDEC J-STD-020D. See picture below.

Figure 36: Soldering Recommendations

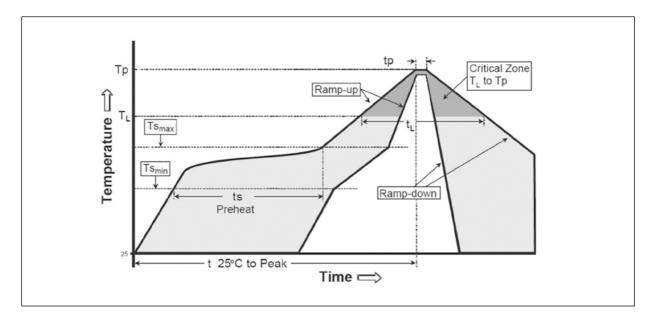

The detailed settings for the reflow profile can be derived from this table.

Figure 37: Soldering Recommendations Table

| Reflow Pro | Reflow Profile Settings | | | | | |
|----------------------------|-------------------------|--|--|--|--|--|
| T _P | 260°C | | | | | |
| tP (time within 5°C of TP) | 20-40 seconds | | | | | |
| T _L | 217°C | | | | | |
| t_L | 60-150 seconds | | | | | |
| Ts _{max} | 200°C | | | | | |
| Ts _{min} | 150°C | | | | | |
| t _s (preheat) | 60 to 180 seconds | | | | | |
| t 25°C to Peak | 8 minutes max. | | | | | |
| ramp up | 3°C/second max. | | | | | |
| ramp down | 6°C/second max. | | | | | |



It is recommended to use a no-clean solder paste for soldering the sensor component on a PCB. There should not be any board wash process, to prevent the sensor area to get in contact with cleaning agents or other liquid materials.



Storage and Handling

The TH09 moisture sensitivity level is 1 (MSL1), which corresponds to an unlimited out-of-bag lifetime at $T = 30^{\circ}C$; RH = 85%RH maximum.

Precautions should be taken to prevent electrostatic discharge (ESD) from damaging the sensor product.

All input and output pins are protected against electrostatic discharge (ESD) under normal handling. When handling ensure that the appropriate precautions are taken as described in JESD625-A or equivalent standards.

The pick-up nozzle of the pick and place machine must be positioned in such a way on the component that it fully covers the cavity of the package, to avoid the leakage of air. Because the TH09 uses a cavity package, where the sensor is in direct contact with the environment, physical contact with sensor should be prevented at all times. If required, dust particles can be removed by gently blowing air inside the cavity of the package. Do not brush or wipe.

For proper operation of the product, exposure to Volatile Organic Compounds (VOCs) should be avoided. During manufacturing, transport and storage, VOCs may originate from out-gassing of glues, adhesive tapes and packaging materials such as bags and foams.

In operation, VOCs might naturally be present in the environment as vapors of, for example, ethanol, acetone and isopropyl alcohol. It is important to realize that some of these contaminants can cause offsets in the sensor reading that may not recover naturally. The same holds for atmospheric pollutants such as ammonia, nitric oxide and chlorine.

Offsets in the sensor reading due to exposure to contaminants may be reversed in certain cases by applying the recommended Reconditioning Procedure (see below Reconditioning). Direct contact with liquid cleaning agents, or rubbing the surface with brushes or cotton-tip sticks, should be avoided at all times.

The sensor is not damaged by water immersion or condensation. The sensor will recover completely when the water evaporates.

Sensor readings are not impacted by high intensity light. This was validated by exposing the sensor to the complete spectrum of a Xe-arc lamp at light levels of 400W/m2 in the range of 290-800 nm, in accordance with ASTM4459.



Reconditioning

The procedures indicated below accelerate the reconditioning of the sensor back to its calibrated state.

After Soldering

After soldering according to Figure 36, RHS reading may show an offset of -2%RH compared to its calibrated value. This offset will slowly disappear if the device is exposed to normal ambient conditions (e.g. T = 25°C, RH = 45%RH, for a week). To accelerate return to its initial calibrated state, we recommend to expose devices to 25°C and 75%RH for 12 hours. This would reduce the time it has to recover at normal ambient conditions before usage.

After Extreme Conditions

If the device is exposed to conditions outside the 'specified safe operating range' for a long time, RH reading may show an offset compared to its calibrated value.

The following procedure accelerates the reconditioning of the sensor back to its calibrated state:


- A mild baking step at 105°C for 12 hours, to evaporate the contaminant.
- A hydration step at 25°C and 75%RH for 12 hours, to rehydrate the sensor material.
- A soak step at normal ambient conditions (e.g. 23°C ± 3°C, 35-55%RH) for 24 hours.



Package Drawings & Markings

The TH09 has SMD and DIP package: plastic thermal enhanced very thin small outline package; no leads; 4 terminals; body $10.8 \times 9.1 \times 1.55 \text{mm}$, see Figure 39.

Figure 39: Package Outline

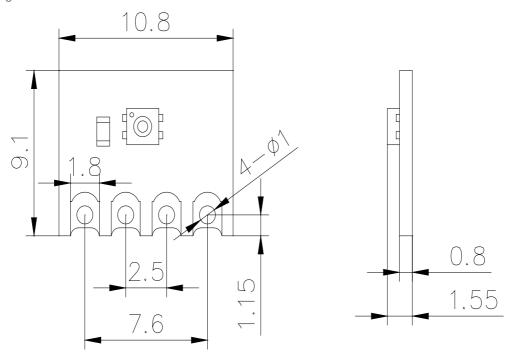

Note(s):

- 1. Dimensioning and tolerancing conform to ASME Y14.5M-1994.
- 2.All dimensions are in millimeters. Angles are in degrees.
- 3. Dimension b applies to metallized terminal and is measured between 0.15mm and 0.30mm from terminal tip.
- 4. Unilateral coplanarity applies to the exposed heat sink slug as well as the terminal.
- 5.N is the total number of terminals.