
Delivery Specification	No.	Page
Part Name	L-KLS3-2325WT	2/3
Ceramic Ultrasonic Sensor NU2	NINGBO KLS ELECTRO	ONIC CO.,LTD


- 1. Scope
- 2. Outline Dimensions (Unit: mm)

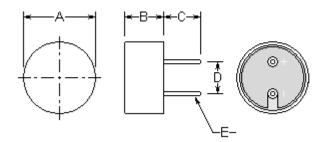

 $A = \emptyset 25.0\pm0.5$   $B = 12.0\pm0.5$   $C = 11.0\pm0.5$   $D = 10.0\pm0.5$   $E = \emptyset 1.0\pm0.1$ 

3.Test Circuit (23Khz 10Vp-p/30cm 0dB = 20uBar)

## Transmitter




A: Oscillator B: Amplifier C: Voltmeter MIC: Microphone T.U.S.: Transmitter Ultrasonic Sensor F.C.: Frequency Counter

## 4. Characteristics

Part number	NU23A25T
Using Method	Transmitter
Construction	Water proof type
Center frequency	23.0±1.0KHz
Sound pressure level	113dB min.
Capacitance	2500Pf±20%
Maximum input voltage	180Vp-p
Directivity	50°±15° (-6dB)
Operating temperature	-20°C~+70°C
Storage Temperature	-40°C~+85°C


Delivery Specification	No.	Page
Part Name	L-KLS3-2325WT	3/3
Ceramic Ultrasonic Sensor NU2	NINGBO KLS ELECTRONIC CO.,LTD	

5.Frequency & Impredance

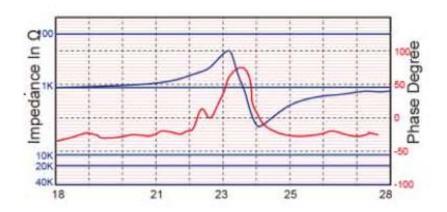


Frequency In kHz

# 6.Sentivity & Sound Pressure Level

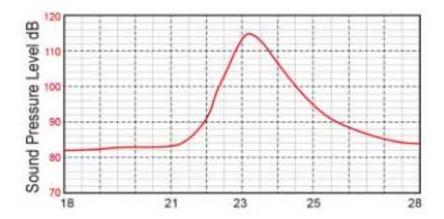

# 7.Directivity

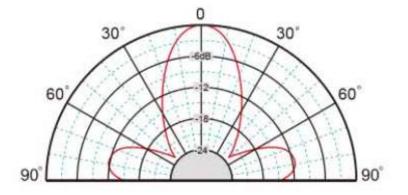

Delivery Specification	No.	Page
Part Name	L-KLS3-2325WT	3/3
Ceramic Ultrasonic Sensor NU2	NINGBO KLS ELECTRONIC CO.,LTD	

- 8. environmental Characteristics
- 8.1 Sound pressure level and sensitivity shall not change by more than 15dB in temperature range of -20°C to 70°C, At a relative humidity of 30%.
- 8.2 Sound pressure level and sensitivity shall not change by more than 6dB in the humidity of 10% to 90%, At the temperature of 25°.

#### 8.3 MOISTURE

Keep the sensor at 40°C±2°C and 90°C to 95°C R.H for 96±4 hours. Then, release the sensor into the room conditions for 24 hour prior to the measurement. It shall fulfill the specifications in Table 1.

## 8.4 VIBRATION

Subject the sensor to the vibration for 1 hour each in the X.Y and Z axes with the amplitude of 1.5mm at 10 to 55 Hz. It shall fulfill the specifications in Table 1.

#### 8.5 HIGH TEMPERATURE EXPOSURE

Subject the sensor to 80±5°C for 24±1 hours. then, release the sensor into the room conditions for 1 hour prior to the measurement. It shall meet the specifications in Table 1.

### 8.6 LOW TEMPERATURE EXPOSURE

Subject the sensor to -30±5°C for 24±1 hours. Then release the sensor into the room conditions for 1 hour prior to the measurement. It shall meet the specifications in Table 1.

## TABLE 1

ITEM	SPECIFICATION
Center Frequency	Within 0.5KHz Compared With Initial Values
Sound Pressure Level	Within 3dB Compared With Initial Values
Sensitivity	Within 3dB Compared With Initial Values

### **\*** NOTES

- This sensor is designed for use in air. Do not use this sensor in fluid.
- To prevent sensor malfunctions, operational failure or any deterioration of its characteristics, do not use this sensor in the following, or similar conditions.

A. In strong shock or vibration.

B. In high temperature and humidity for a long time.

C.In corrosive gases or sea breeze.

D.In an atmosphere of organic solvents.

E. In dirty and dusty environments that may contaminate the sensor front.